



BY SPEED POST

B-29016/04/06/IPC-I/2443

June 11, 2019

To

M/s. Flora Dyeing House (P) Limited,
Plot No. 392, Phase- 1, HSIIDC, Barhi,
Sonipat-131101, Haryana

Sub: Directions under Section 5 of the Environment (Protection) Act, 1986 -reg.

WHEREAS, the Textile (Dyeing) industries are identified as one of the Grossly Polluting Industries which have been discharging effluents directly or indirectly on land and into water, having potential threat to cause adverse effect on land and the ambient water quality; and

WHEREAS, the Central Government has notified the standards for discharge of environmental pollutants from various categories of industries under the Environment (Protection) Act, 1986 and the rules framed thereunder; and

WHEREAS, it is obligatory on the part of industries to install and operate Effluent Treatment plant (ETP) to comply with the effluent discharge standards as notified under the Environment (Protection) Act, 1986 and the Rules framed thereunder and also to meet the consent conditions granted by State Pollution Control Board (SPCB)/ Pollution Control Committees (PCCs); and

WHEREAS, Hon'ble Supreme Court of India in the matter of Paryavaran Suraksha Samiti Vs Union of India & Others dated 22/02/2017 directed that no industry which requires "consent to operate" from the concerned Pollution Control Board, is permitted to function, unless it has a functional effluent treatment plant, which is capable to meet the prescribed norms for removing the pollutants from the effluent, before it is discharged; and

WHEREAS, a team of officers from the Central Pollution Control Board (CPCB), Regional Directorate, Lucknow inspected M/s. Flora Dyeing House (P) Ltd., Sonipat, Haryana (herein after referred as the Unit) on April 03, 2019 to assess the adequacy of the existing pollution control measures; and

WHEREAS, the inspecting team found the Unit operational and observed the following:

1. During the Visit, the Effluent Treatment Plant (ETP) was operational. The analysis result of effluent samples collected from ETP outlet was found exceedance w.r.t parameters TDS (2910 mg/l i.e. > 2100 mg/l) and Sodium absorption ratio (SAR) (28.8 i.e. > 26) as per HSPCB Standards for discharge of effluents from Textile industry.
2. The Unit has not obtained valid authorization under Hazardous and other waste (Management & Transboundary Movement) Rule, 2016.
3. During visit, manual dosing was observed at flash mixer and tube settler.
4. The Unit has not provided the gauge at filtration system for measuring head loss to avoid leakage.
5. The Unit has not maintained logbook of electromagnetic flow meter installed at ETP outlet.

Wij

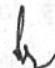
6. The Unit has not provided the separate room for temporarily storage of the hazardous waste.
7. The Unit has not maintained the log book for hazardous waste generation/disposal.
8. During visit, the equalization cum collection tank of the ETP was overflowing and ponding of water also observed in & around the ETP.
9. During visit, the dual media filter was found choked and reported that filter media was not replaced since installation.

WHEREAS, the Ministry of Environment & Forests, Government of India, vide Notifications No. S. O. 157 (E) of 27.02.1996 and S. O. 730 (E) dated 10.07.2002, has delegated the powers vested under Section 5 of the Environment (Protection) Act, 1986 (29 of 1986) to the Chairman, Central Pollution Control Board, to issue directions to any industry or any local body or any other authority for violations of the standards and rules notified under the Environment (Protection) Rules, 1986 and amendment thereof.

NOW, THEREFORE, in exercise of powers vested under Section 5 of the Environment (Protection) Act, 1986, the Unit (M/s. Flora Dyeing House (P) Ltd., Sonipat, Haryana) is directed to close all the plant operations with immediate effect and shall not resume its operation till following are complied with and written permission is obtained from CPCB:

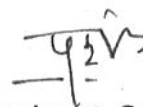
1. The Unit shall carry out adequacy assessment of ETP from Government institute and accordingly upgrade & operate Effluent Treatment Plant (ETP) properly so as to achieve prescribed standards.
2. The Unit shall obtain valid authorization under Hazardous and Other waste (Management & Transboundary Movement) Rule, 2016 from HSPCB.
3. The Unit shall provide automatic dosing system at ETP.
4. The Unit shall provide the gauge at filtration system for measuring head loss to avoid leakage.
5. The Unit shall maintain logbook of electromagnetic flow meter installed at ETP outlet.
6. The Unit shall provide separate room for temporarily storage of Hazardous waste with impervious flooring.
7. The Unit shall maintain logbook for hazardous waste generation/disposal.
8. The Unit shall enhance hydraulic capacity of the collection cum equalization system.
9. The Unit shall replace the media/resins of the dual media filter.

In case of failure to comply with the said directions necessary action as deemed fit under the provision of the Environment (Protection) Act, 1986 will be taken by Central Pollution Control Board.


12/06/18
(S.P. Singh Parihar)
Chairman

Copy to:

1. The Chairman
Haryana State Pollution Control Board
C-11, Sector - 6, Panchkula,
Haryana- 134109
2. The Joint Secretary (CP Division)
Ministry of Environment, Forests and Climate Change
Prithvi Wing, 2nd Floor, Room No. 216
Indira Paryavaran Bhawan Aliganj,
Jor Bagh Road, New Delhi - 110003
3. The Managing Director,
Uttar Haryana Bijli Vitran Nigam Ltd. : With request to disconnect
(UHBVNL) Vidyut Sadan, industrial Electricity supply of
Plot No: C16, Sector-6, the Unit, allowing the supply
Panchkula, Haryana- 134109 only for domestic & security
purposes.
4. The Incharge, Regional Directorate
Central Pollution Control Board
Ground & First Floor, PICUP Bhawan
Vibhuti Khand, Gomti Nagar
Lucknow - 226 020
- ✓ 5. D. H., IT, CPCB
6. D. H., IPC-III, CPCB


(Prashant Gargava)
Member Secretary

