



BY REGISTERED AD

July 23, 2018

B-29016/04/06/IPC-I/ 600

To

M/s. M. R. Engineers,  
Plot No. 33, HSIIDC, Murthal,  
Sonipat- 131001, Haryana

Sub: Directions under Section 5 of the Environment (Protection) Act, 1986 -reg.

WHEREAS, the Central Government has notified the standards for discharge of environmental pollutants from various categories of industries under the Environment (Protection) Act, 1986 and the rules framed thereunder; and

WHEREAS, it is obligatory on the part of industries to install and operate Effluent Treatment plant (ETP) to comply with the effluent discharge standards as notified under the Environment (Protection) Act, 1986 and the Rules framed thereunder and also to meet the consent conditions granted by State Pollution Control Board (SPCB)/ Pollution Control Committees (PCCs); and

WHEREAS, Hon'ble Supreme Court of India in the matter of Paryavaran Suraksha Samiti Vs Union of India & Others dated 22/02/2017 directed that no industry which requires "consent to operate" from the concerned Pollution Control Board, is permitted to function, unless it has a functional effluent treatment plant, which is capable to meet the prescribed norms for removing the pollutants from the effluent, before it is discharged; and

WHEREAS, a team of officers from the Central Pollution Control Board (CPCB), Delhi inspected M/s. M. R. Engineers, Sonipat (herein after referred as the Unit) on May 21, 2018 to assess the adequacy of the existing pollution control measures; and

WHEREAS, the inspecting team found the Unit was non-operational due to power outage and observed the following:

1. The ETP of the Unit was found non-operational during visit and the flow meter installed at the ETP was also non-operational.
2. The unit has not maintained records for waste water generated and treated effluent.
3. Sample was collected from outlet of the ETP. The analysis results of the sample are exceeding the prescribed limit w.r.t parameters pH (2.56 < 5.5-9.0), TSS (111 > 100 mg/l), Cr (724 > 2 mg/l), Cu (6.08 > 3 mg/l), Fe (12.44 > 3 mg/l), Mn (11.13 > 2 mg/l), Ni (4.40 > 3 mg/l), Zn (914.70 > 5 mg/l).
4. The unit has not maintained the records of Hazardous waste (waste powder generated from powder coating) generated from the process.
5. The unit has not installed the flow meter on the bore well for ground water extraction and records are not maintained for daily water consumption.

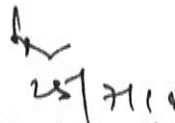

WHEREAS, the Ministry of Environment & Forests, Government of India, vide Notifications No. S. O. 157 (E) of 27.02.1996 and S. O. 730 (E) dated 10.07.2002, has delegated the powers vested under Section 5 of the Environment (Protection) Act, 1986 (29 of 1986) to the Chairman, Central Pollution Control Board, to issue directions to any industry or any local body

or any other authority for violations of the standards and rules notified under the Environment (Protection) Rules, 1986 and amendment thereof.

**NOW, THEREFORE**, in exercise of powers vested under Section 5 of the Environment (Protection) Act, 1986, the following directions are being issued:


1. The Unit shall close all the plant operations with immediate effect.
2. The Unit shall operate Effluent Treatment Plant properly so as to achieve prescribed standards for effluent discharge.
3. The Unit shall install the flow meter at the ETP and Bore Well for extraction of ground water and maintain the log book for consumption of water and waste water generated.
4. The Unit shall dispose its Hazardous wastes in accordance with The Hazardous and other Wastes (Management & Transboundary Movement) Rules, 2016 with proper record maintenance.
5. The Unit shall not resume the operation till the compliance of above direction and permission is obtained from the CPCB for the same.

In case of failure to comply with the said directions necessary action as deemed fit under the provision of the Environment (Protection) Act, 1986 will be taken by Central Pollution Control Board.

  
(S.P. Singh Parihar)  
Chairman  


Copy to:

1. The Chairman  
Haryana State Pollution Control Board  
C-11, Sector - 6, Panchkula, Haryana
2. The Advisor (CP Division)  
Ministry of Environment, Forests and Climate Change  
Prithvi Wing, 2nd Floor, Room No. 216  
Indira Paryavaran Bhawan  
Aliganj, Jor Bagh Road New Delhi - 110003
3. The Managing Director,  
Uttar Haryana Bijli Vitran Nigam Ltd.  
(UHBVNL) Vidyut Sadan,  
Plot No: C16, Sector-6,  
Panchkula, Haryana : With request to disconnect  
industrial Electricity supply of  
the Unit, allowing the supply  
only for domestic & security  
purposes.
4. The Incharge, Regional Directorate  
Central Pollution Control Board  
Ground & First Floor, PICUP Bhawan  
Vibhuti Khand, Gomti Nagar  
Lucknow - 226 020
- ✓ 5. I/c, IT, CPCB

  
(Prashant Gargava)  
Member Secretary