



केन्द्रीय प्रदूषण नियंत्रण बोर्ड
CENTRAL POLLUTION CONTROL BOARD
पर्यावरण, वन एवं जलवायु परिवर्तन मंत्रालय भारत सरकार
MINISTRY OF ENVIRONMENT, FOREST & CLIMATE CHANGE GOVT. OF INDIA

BY SPEED POST

B-29016/04/06/IPC-I/ 2107

May 27, 2019

To

M/s. Weave N Colors Texofab,
Plot No. 490, HSIIDC Barhi,
Sonipat, Haryana - 131001

Sub: Directions under Section 5 of the Environment (Protection) Act, 1986 -reg.

WHEREAS, the Textiles (Dyeing) industries are identified as one of the Grossly Polluting Industries which have been discharging effluents directly or indirectly on land and into water, having potential threat to cause adverse effect on land and the ambient water quality; and

WHEREAS, the Central Government has notified the standards for discharge of environmental pollutants from various categories of industries under the Environment (Protection) Act, 1986 and the rules framed thereunder; and

WHEREAS, it is obligatory on the part of industries to install and operate Effluent Treatment plant (ETP) to comply with the effluent discharge standards as notified under the Environment (Protection) Act, 1986 and the Rules framed thereunder and also to meet the consent conditions granted by State Pollution Control Board (SPCB)/ Pollution Control Committees (PCCs); and

WHEREAS, Hon'ble Supreme Court of India in the matter of Paryavaran Suraksha Samiti Vs Union of India & Others dated 22/02/2017 directed that no industry which requires "consent to operate" from the concerned Pollution Control Board, is permitted to function, unless it has a functional effluent treatment plant, which is capable to meet the prescribed norms for removing the pollutants from the effluent, before it is discharged; and

WHEREAS, a team of official of Central Pollution Control Board (CPCB), Regional Directorate, Lucknow inspected M/s. Weave N Colors Texofab, Plot No. 490, HSIIDC Barhi, Sonipat, Haryana (herein after referred as the Unit) on April 03, 2019 to assess the adequacy of the existing pollution control measures and the inspecting team observed the following:

1. The Unit was operational but ETP of the Unit was found non-operational during visit and ETP of the Unit was found almost in defunct condition.
2. The waste water generated from the process may be considered as outlet of ETP and characteristics of the effluent was not meeting the CETP inlet norms w.r.t. pH: 5.92 < 6.0-9.0, COD: 4204 > 1400 mg/l, BOD: 1702 > 500 mg/l, TDS: 5020 > 2100 mg/l, Sulphide: 08 > 02 mg/l.
3. The Total Chromium contain in the effluent is very high i.e 10.98 > 2.0 mg/l.
4. The Unit has not obtained Hazardous Waste Authorization from HSPCB under Hazardous and Other Wastes (Management and Transboundary Movement) Rules, 2016.
5. The Unit has not provided designated area for temporary storage of Hazardous Waste and Unit is not maintaining the proper records of Hazardous Waste generation & disposal.

Page | 1

6. The Unit is not maintaining records of ground water withdrawal.

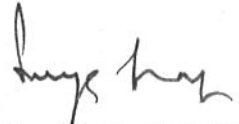

WHEREAS, the Unit has not operated the Effluent Treatment Plant continuously, which is non-compliance under section 5 of the E(P) Act, 1986 and action including imposing environmental compensation charges as per law shall be taken; and

WHEREAS, the Ministry of Environment & Forests, Government of India, vide Notifications No. S. O. 157 (E) of 27.02.1996 and S. O. 730 (E) dated 10.07.2002, has delegated the powers vested under Section 5 of the Environment (Protection) Act, 1986 (29 of 1986) to the Chairman, Central Pollution Control Board, to issue directions to any industry or any local body or any other authority for violations of the standards and rules notified under the Environment (Protection) Rules, 1986 and amendment thereof.

NOW, THEREFORE, in exercise of powers vested under Section 5 of the Environment (Protection) Act, 1986, the Unit is directed to close all the plant operations with immediate effect and shall not resume its operation till following are complied with and written permission is obtained from CPCB:

1. The Unit shall maintain and operate Effluent Treatment Plant properly so as to achieve prescribed CETP inlet standards and Unit shall submit the adequacy report of ETP from any reputed government institute.
2. The Unit shall not by-pass the untreated effluent.
3. The Unit shall provide Chromium treatment system at the ETP.
4. The Unit shall obtain Hazardous Waste Authorization from HSPCB under Hazardous and Other Wastes (Management and Transboundary Movement) Rules, 2016.
5. The Unit shall provide adequate storage facility for Hazardous Waste and Unit shall maintain the records of Hazardous Waste generation & disposal.
6. The Unit shall maintain proper records of ground water withdrawal.

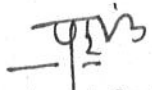
In case of failure to comply with the said directions necessary action as deemed fit under the provision of the Environment (Protection) Act, 1986 will be taken by Central Pollution Control Board.


(S.P. Singh Parihar)
Chairman


M/s. Weave N Colors Texofab, Sonapat, Haryana

Copy to:

1. The Chairman
Haryana State Pollution Control Board
C-11, Sector - 6, Panchkula,
Haryana - 134109 : For ensuring immediate closure
of the Unit.
2. The Joint Secretary,
Ministry of Environment, Forests and Climate Change
Prithvi Wing, 2nd Floor, Room No. 216
Indira Paryavaran Bhawan
Aliganj, Jor Bagh Road
New Delhi - 110003 : For information please.
3. The Managing Director,
Uttar Haryana Bijli Vitran Nigam Ltd.
(UHBVNL) Vidyut Sadan,
Plot No: C16, Sector-6,
Panchkula, Haryana-134109 : With request to disconnect
Industrial Electricity supply of
the Unit, allowing the supply
only for domestic & security
purposes.
4. The Incharge, Regional Directorate
Central Pollution Control Board
Ground & First Floor, PICUP Bhawan
Vibhuti Khand, Gomti Nagar
Lucknow - 226 020 : For information please.
5. I/c, IPC-III, CPCB
6. I/c, IT, CPCB


(Prashant Gargava)
Member Secretary